

Work Order ID 83863

April-26-12 2:28:11 PM

83863

Page 1

Item ID: D3391-021 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Fwd Tube Assembly
 Start Date: 26/04/2012 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 10/05/2012 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: MLJ Date: 12/04/24 Tooling: Date: Run Start ***NR1***
 QC: Date: SPC (Y/N): Date: Stop ***NR2***

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
|--------------------------------|--------------------------|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|

| Draw Nbr | Revision Nbr |
|----------|--------------|
| D3391 | I |

| | | | | | | | | | |
|--------------|--------------------------------------|------|--|--|--|--|--|--|--|
| 100 | | 0.00 | | | | | | | |
| *100* | Skidtubes | | | | | | | | |
| Skidtubes | Memo | 0.00 | | | | | | | |
| Skidtubes | Cut extrusion to 46.52 +0.010 -0.020 | | | | | | | | |

DL 12/08/22

| | | | | | | | | | |
|----------------------|---|------|--|--|--|--|--|--|--|
| 110 | | 0.00 | | | | | | | |
| *110* | BENDING MACHINE - SKIDTUBES | | | | | | | | |
| CNC Bend I | Memo | 0.00 | | | | | | | |
| CNC Delta 100 Bender | Bend as per Dwg D3391 Using Bend Prog 3391021 | | | | | | | | |

DL 12/05/31

| | | | | | | | | | |
|-----------------|---|------|--|--|--|--|--|--|--|
| 120 | | 0.00 | | | | | | | |
| *120* | QC5- Inspect part completeness to step on W/O | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |

6.9"

DP 12-6-1

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 2

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N9000040100

Setup Start *NS1*

Revision ID:

Item Name: Fwd Tube Assembly

Stop *NS2*

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

| Sequence ID/ Work Center ID | Operation Description | Set Up/ Run Hours | Tool ID | Tool # | Plan Code | Accept Qty | Reject Qty | Reject Number | Insp. Stamp |
|--------------------------------|--|----------------------|---------|--------|--------------|---------------|---------------|------------------|----------------|
| 130 | | 0.00 | | | | | | | |
| *130* | HAAS CNC VERTICAL MACHINING #1 | | | | | | | | |
| HAAS I | Memo | 0.00 | | | | | | | |
| HAAS CNC vertical machine #1 | 1-Machine as per Folio FA590 Rev. <i>12/6/3</i> & Dwg D3391 Rev. <i>1</i> Identify as D3391-1 2-Deburr | | | | | | | | |
| 140 | | 0.00 | | | | | | | |
| *140* | QC2- Inspect parts off machine FAI/FAIB | | | | | | | | |
| QC | Memo | 0.00 | | | | | | | |
| Quality Control | | | | | | | | | |
| 150 | | 0.00 | | | | | | | |
| *150* | CONVENTIONAL MILLING MACHINE | | | | | | | | |
| Mill Conv | Memo | 0.00 | | | | | | | |
| Conventional Milling Machine | Drill X1 Aft cap as per Dwg D3391 .1875" dia | | | | | | | | |

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 3

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Fwd Tube Assembly

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start ***NR1***

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop ***NR2***

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC2- Inspect parts off machine FAI/FAIB

0.00

160

QC

Memo

0.00

Quality Control

12/06/05

1 0

170

QC8- Inspect parts - second check

0.00

170

QC

Memo

0.00

Quality Control

SA 12615

1

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 4

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Fwd Tube Assembly

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

180

0.00

180

Skidtubes

Skidtubes

Memo

0.00

1-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

2-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5- open float bag holes 0.328" and counter sink as per dwg D3391

6-Deburr & Scribe Batch number Inside aft end.

7-Transfer drill D3391-021 with D3391-023

NO WEARPLATE HOLES ARE TRANSFER DRILLED

Dec 12 / 06 / 12

Dec 12 / 08 / 02

- Dec 12 / 08 / 02

190

QC5- Inspect part completeness to step on W/O

0.00

190

QC

Memo

0.00

Quality Control

DAS
16

12/08/03

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

83863

Page 5

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 26/04/2012 **Start Qty:** 1.00

*** 1 ***

Cust Item ID:

Required Date: 10/05/2012 **Req'd Qty:** 1.00

*** 1 ***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

**Insp.
Stamp**

0.00

200

HandFinish

Memo

0.00

Hand Finishing

0.00

210

QC

Memo

0.00

Quality Control

0.00

220

Skidtubes

Memo

0.00

Skidtubes

1-instal spacers as per dwg D3391

A/R Magnabond 6398 batch: M/20666

exp. date: 13-1-30

cure time 12hrs. as per QSI015

2- grind crossbolt flush

3-back drill crossbolt if necessary

- De 12/08/08

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 6

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Fwd Tube Assembly

Stop

NS2

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

230

QC5- Inspect part completeness to step on W/O

0.00

230

QC

Memo

0.00

Quality Control

235

Pressure Wash per QSI005 4.3

0.00

235

HandFinish

Memo

0.00

Hand Finishing

AND REALODINE AS PER PAR09-043

240

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

240

Powdercoat

Memo

0.00

Powder Coating

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

9:40
320 OF

10:10

W122878

1 26 12-9-27

EXP 12/29/28

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 7

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Fwd Tube Assembly

Stop *NS2*

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

250

QC3- Inspect Part Finish

0.00

250

QC

Memo

0.00

Quality Control

1x d 94 12/10/10

255

Skidtubes

0.00

255

Skidtubes

Memo

0.00

Skidtubes

✓ **** install D3591-1 spacer as per DSI9364 and wearplate as per DWG ****

1x d 94 12/10/10

257

QC5- Inspect part completeness to step on W/O

0.00

257

QC

Memo

0.00

Quality Control

DAS
16
17/10/12

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Work Order ID 83863

83863

Page 8

April-26-12 2:28:11 PM

Item ID: D3391-021

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Fwd Tube Assembly

Stop *NS2*

Start Date: 26/04/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

260

Identify as per dwg & Stock Location: w16

0.00 0412-742-043 / 1387068

260

Packaging

Memo

0.00

Packaging

1x / 12/10/10

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Memo

0.00

Quality Control

12/10/30

MR

12-10-02

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Picklist Print

April-26-12 2:28:15 PM

Page 1

Work Order ID: 83863

83863

Parent Item: D3391-021

D3391-021

Parent Item Name: Fwd Tube Assembly

Start Date: 26/04/2012

Required Date: 10/05/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.09.13New issue KJ/JLM
 IPP B06.02.10Dwg rev.D ecn 773 EC
 IPP C06.05.02Added inspections EC
 IPP D 07.03.13 rev F dwg EC
 IPP E 07.11.07 revG dwg ecn1053P EC verified by: DD
 IPP Rev:f ECN 1056 07-11-12 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev I 09.02.02 added hardware EC verified by: DD IPP Rev:J
 11.11.14 AS PER REV.I DD verified by:JLM

| Component Item ID/ Item Name | Replacement Item ID | Mfg/ Purch | Bin Item | Primary Location | Last Location | Route Seq ID | Unit of Measure | Qty on Hand | Qty per Kit | Total Qty | Qty Issued | Date Issued | Status |
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|
|---------------------------------|------------------------|---------------|-------------|---------------------|------------------|-----------------|--------------------|----------------|-------------|--------------|---------------|----------------|--------|

| | | | | | | | | | | | | | |
|--------------------|--|--------------|----|--|--|-----|------|---------|----|----|----------|--|--|
| D4095-051 | | Manufactured | No | | | 255 | Each | 29.0000 | 1 | 1 | | | |
| *D4095-051* | | | | | | | | | ** | yl | 11/10/01 | | |
| Wearpad Assembly | | | | | | | | | | | | | |

| Location | Loc Qty | Loc Code |
|----------|---------|----------|
| FP002 | 29 | |
| 78914 | 7 | |
| 81613 | 22 | |

| | | | | | | | | | | | | | |
|--------------------|--|--------------|----|--|--|-----|------|----------|----|----|----------|--|--|
| D6013-047 | | Manufactured | No | | | 100 | Each | 102.0000 | 1 | 1 | | | |
| *D6013-047* | | | | | | | | | ** | pe | 12/08/22 | | |
| Skidtube Material | | | | | | | | | | | | | |

| Location | Loc Qty | Loc Code |
|----------|---------|----------|
| LG | 102 | |
| 72505 | 102 | |

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Picklist Print

April-26-12 2:28:15 PM

Page 2

Work Order ID: 83863

83863

Parent Item: D3391-021

D3391-021

Parent Item Name: Fwd Tube Assembly

Start Date: 26/04/2012

Required Date: 10/05/2012

Start Qty: 1.00

Required Qty: 1.00

D3670-4-200

Manufactured No

220

Each

55.0000

4

4

D3670-4-200

SPACER

**

DL 12/08/08

Location

1385460

Loc Qty

Loc Code

LG

40

80360

40

LG001

15

72851

3

78606

12

D3401-041

Manufactured No

255

Each

17.0000

1

1

D3401-041

Tow Cap Assembly

**

HL 12/10/01

Location

Loc Qty

Loc Code

FP002

17

78990

2

82302

15

AN960C10L

NAS1149C0332

Purchased

No

255

Each

0.0000

10

10

***AN960C10I ***

washer

AN3C4A

Purchased

No

255

Each

1,915.000

10

10

AN3C4A

BOLT

**

HL 12/10/01

Location

Loc Qty

Loc Code

ST350

1915

120187

849

120521

28

120769

38

121205

1000

M 122814

x10

April-26-12 2:28:15 PM

Shop Packet Print

Page 2

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Picklist Print

April-26-12 2:28:15 PM

Page 3

Work Order ID: 83863

83863

Parent Item: D3391-021

D3391-021

Parent Item Name: Fwd Tube Assembly

Start Date: 26/04/2012

Required Date: 10/05/2012

Start Qty: 1.00

Required Qty: 1.00

D3672-1

Manufactured No

255

Each

842.0000

4

4

D3672-1

**

yl

nl10101

Phenolic Washer

Location

Loc Qty

Loc Code

ST060

842

B85222

ycl

72229

4

76277

338

80369

500

AELS-1032-225

Purchased

No

255

Each

0.0000

10

10

AFI S-1032-225 *

**

(x10)

yl 1210101

INSERT

ALST-1032-225 / M122290

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

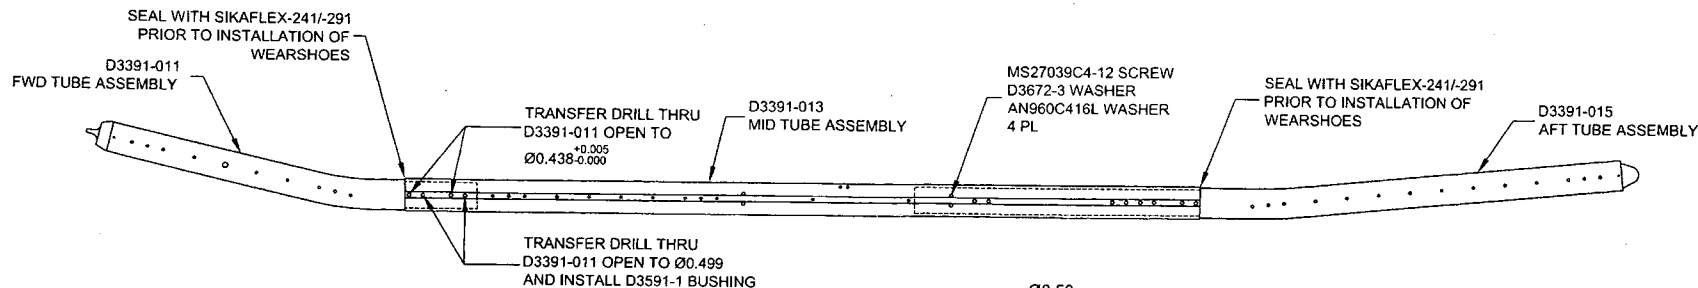

SHOP COPY
RETURN TO
ENGINEERING

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 83863 MCV
12/04/26

RELEASED
2011-11-04
ECN# 11-662

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

| QTY -041 | PART NUMBER | DESCRIPTION |
|----------|--------------|-------------------------|
| X | D3391-041 | FLOAT SKIDTUBE ASSEMBLY |
| 1 | D3391-011 | FWD TUBE ASSEMBLY |
| 1 | D3391-013 | MID TUBE ASSEMBLY |
| 1 | D3391-015 | AFT TUBE ASSEMBLY |
| 2 | D3591-1 | BUSHING |
| 4 | D3672-3 | WASHER |
| 1 | D4095-041 | WEARSHOE |
| 1 | D4095-043 | WEARSHOE |
| 1 | D4095-045 | WEARSHOE |
| 1 | D4095-047 | WEARPAD |
| 1 | D4095-049 | WEARPAD |
| 1 | D4095-051 | WEARSHOE |
| 24 | AN3C4A | BOLT |
| 10 | AN3C6A | BOLT |
| 4 | AN3C7A | BOLT |
| 38 | AN960C10L | WASHER |
| 4 | MS27039C4-12 | SCREW |
| 4 | AN960C416L | WASHER |

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL $\varnothing 0.297$ SIZE HOLES FOR WEARSHOE INSERTS. CBORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL $\varnothing 0.50$ HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL $\varnothing 0.50$ HOLES FROM SADDLE TO D4095-043

| | | | |
|------------|--|-----|----------|
| I | REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8 | XDF | 11.10.13 |
| H | DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 $\varnothing 0.438$ DIM WAS 4 PL. ADDED $\varnothing 0.499$ DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE OSI 9364 & NCR 08-074) | AJS | 08.08.20 |
| G | REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY | DC | 07.07.31 |
| F | ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021 | PH | 07.01.18 |
| E | CHANGE TOLERANCE, EASE MANUFACTURE | PH | 06.04.25 |
| D | UPDATE TOLERANCE, CHANGE HOLE SIZE | PH | 06.01.23 |
| C | LENGTHEN AFT EXTENSION | PH | 05.09.27 |
| B | DRAWING UPDATES | PH | 05.06.10 |
| A | NEW ISSUE | PH | 05.02.07 |
| REV. | DESCRIPTION | BY | DATE |
| DESIGN | PH | | |
| DRAWN | XDF | | |
| CHECKED | | | |
| MFG. APPR. | | | |
| APPROVED | | | |
| DE APPR. | | | |
| DATE | 11.10.13 | | |

DART AEROSPACE USA, INC
KENT, WA

DRAWING NO. D3391
REV. I
SHEET 1 OF 8

TITLE 412 FLOAT SKIDTUBE
SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS UNCLASSIFIED AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

83863

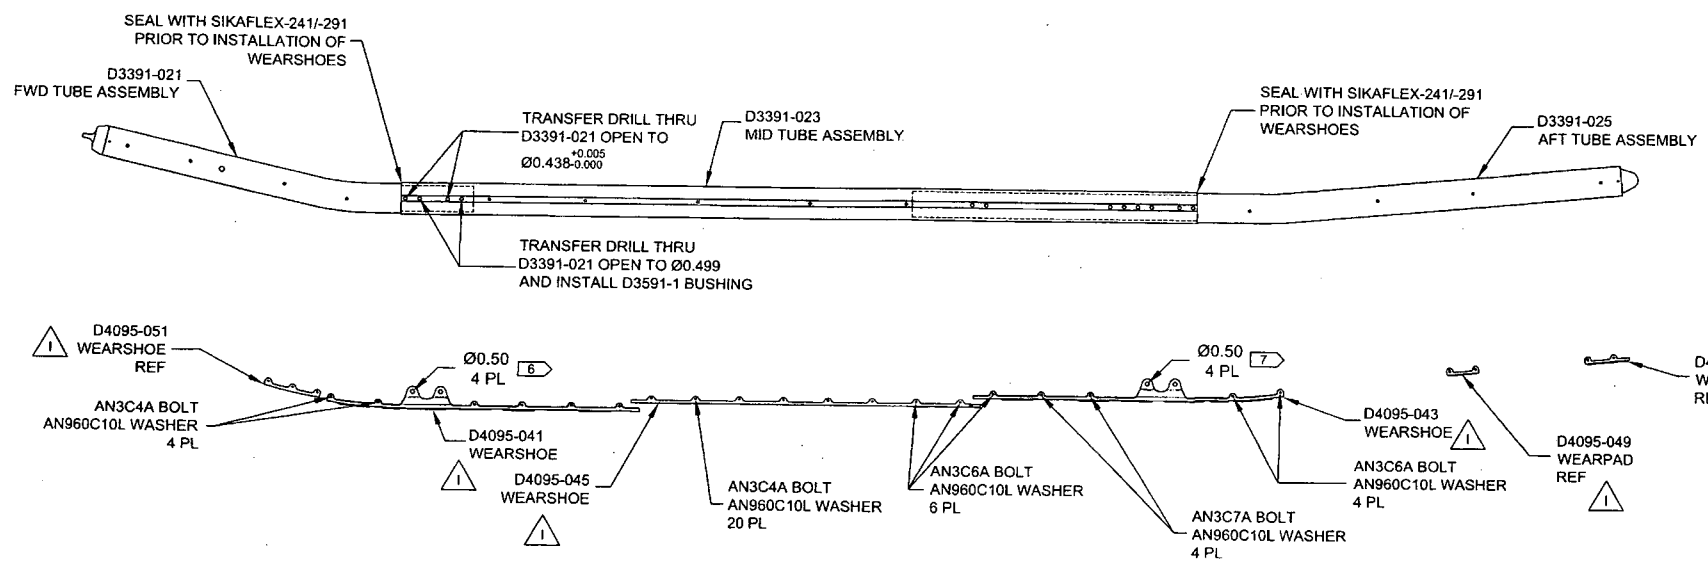

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

| QTY | PART NUMBER | DESCRIPTION |
|-----|-------------|-------------------------|
| X | D3391-043 | FLOAT SKIDTUBE ASSEMBLY |
| 1 | D3391-021 | FWD TUBE ASSEMBLY |
| 1 | D3391-023 | MID TUBE ASSEMBLY |
| 1 | D3391-025 | AFT TUBE ASSEMBLY |
| 2 | D3591-1 | BUSHING |
| 1 | D4095-041 | WEARSHOE |
| 1 | D4095-043 | WEARSHOE |
| 1 | D4095-045 | WEARSHOE |
| 1 | D4095-047 | WEARSHOE |
| 1 | D4095-049 | WEARSHOE |
| 1 | D4095-051 | WEARSHOE |
| 24 | AN3C4A | BOLT |
| 10 | AN3C6A | BOLT |
| 4 | AN3C7A | BOLT |
| 38 | AN960C10L | WASHER |

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04

| | | | | | |
|------------|--|----------|--|--|--|
| DESIGN | | PH | | DART AEROSPACE USA, INC | |
| DRAWN | | XDF | | KENT, WA | |
| CHECKED | | | | DRAWING NO. REV. I | |
| MFG. APPR. | | | | D3391 SHEET 2 OF 8 | |
| APPROVED | | | | TITLE SCALE | |
| DE APPR. | | | | 412 FLOAT SKIDTUBE NTS | |
| DATE | | 11.10.13 | | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |


NOTE: Date & initial all entries

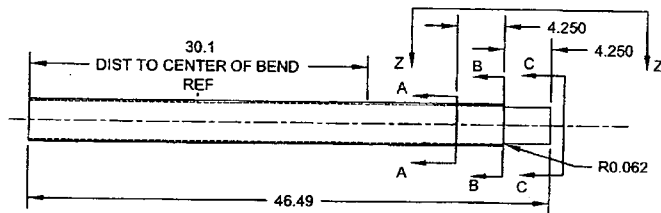


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

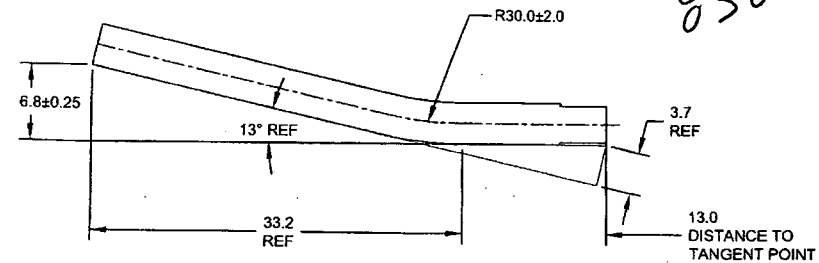


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

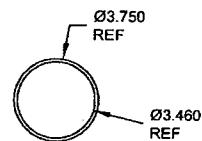


SECTION A-A
SCALE 2X

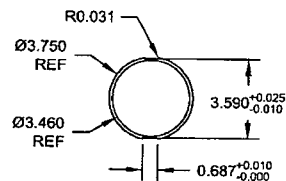

SECTION B-B
SCALE 2X

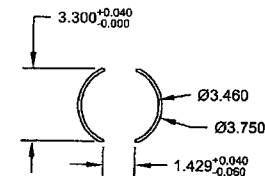

SECTION C-C
SCALE 2X

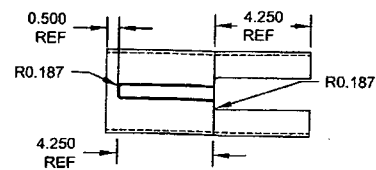

VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 3 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | <small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small> | |

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries


83863

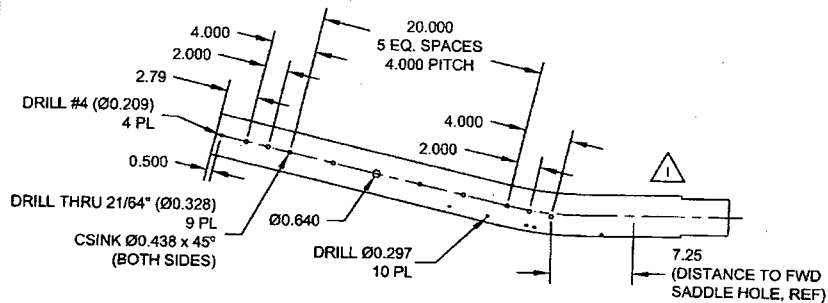


D3391-011 DRILLING DETAIL

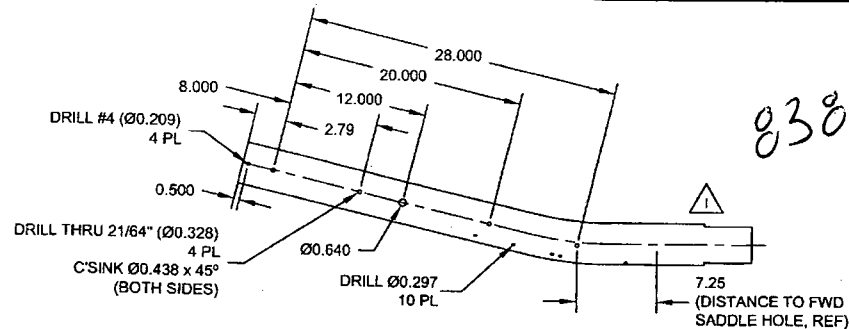

D3391-021 DRILLING DETAIL

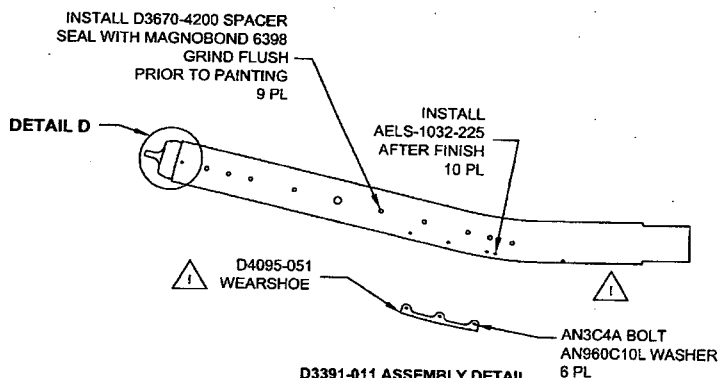

D3391-011 ASSEMBLY DETAIL

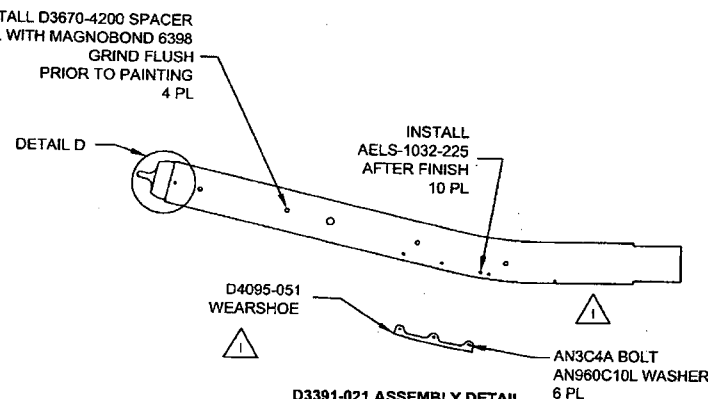

D3391-021 ASSEMBLY DETAIL

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

| QTY - 011 | QTY - 021 | PART NUMBER | DESCRIPTION |
|-----------|-----------|---------------|-------------------|
| X | | D3391-011 | FWD TUBE ASSEMBLY |
| | X | D3391-021 | FWD TUBE ASSEMBLY |
| 1 | 1 | D3401-041 | TOW CAP |
| 9 | 4 | D3670-4200 | SPACER |
| 4 | 4 | D3672-1 | WASHER |
| 1 | 1 | D4095-051 | WEARSHOE |
| 1 | 1 | D6013-047 | FWD TUBE |
| 10 | 10 | AN3C4A | BOLT |
| 10 | 10 | AN960C10L | WASHER |
| 10 | 10 | AELS-1032-225 | INSERT |

SEAL WITH SIKAFLEX-241/-291

D3401-041 TOW CAP

DETAIL D SCALE 2X

AN3C4A BOLT
D3672-1 WASHER
AN960C10L WASHER
4 PL

RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 4 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

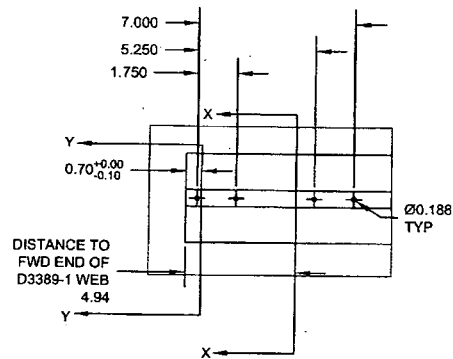


DETAIL J
SCALE 4X

DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

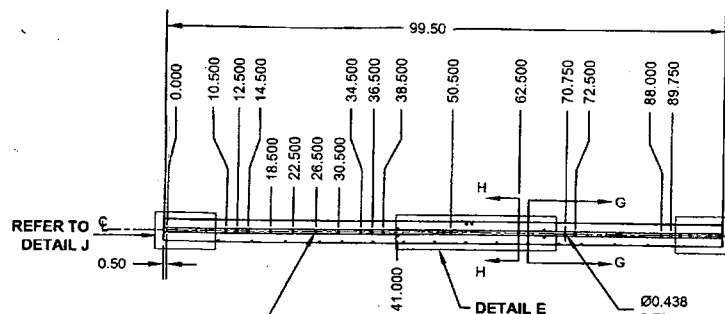


D3391-013 ASSEMBLY DETAIL

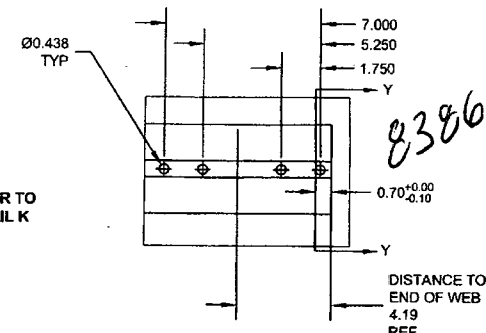

DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

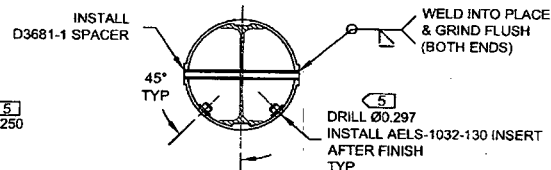


SECTION H-H
SCALE 5X

REMOVE 0.030
FROM TOP AND BOTTOM
TO 3.610

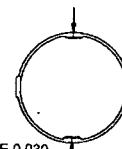

SECTION X-X
SCALE 5X

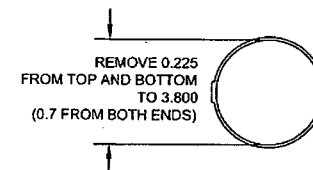


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST


| QTY | PART NUMBER | DESCRIPTION |
|------|---------------|-------------------|
| -013 | | |
| X | D3391-013 | MID TUBE ASSEMBLY |
| 1 | D2500-1-100 | EXTRUSION |
| 1 | D3389-1 | WEB |
| 4 | D3672-1 | WASHER |
| 4 | D3672-3 | WASHER |
| 12 | D3681-1 | SPACER |
| 24 | AELS-1032-130 | INSERT |
| 4 | ALS4-428-165 | INSERT |
| 4 | AN960C10L | WASHER |
| 4 | AN960C416L | WASHER |
| 4 | MS27039C1-09 | SCREW |
| 4 | MS27039C4-08 | SCREW |

D3391-013 MID TUBE ASSEMBLY


- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- WELDING: PER DART QSI 004

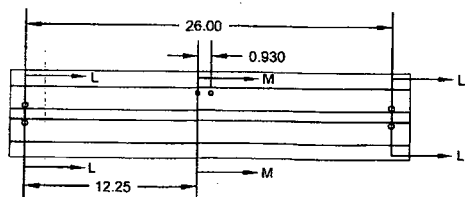


DETAIL E
SCALE NONE

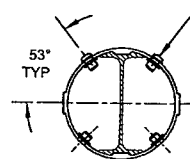

SECTION M-M
SCALE 5X

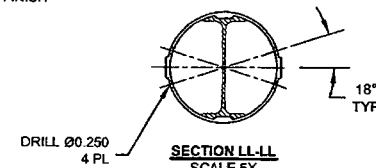

SECTION LL-LL
SCALE 5X

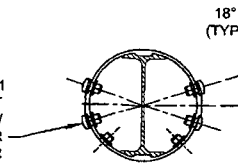

SECTION L-L
SCALE 5X

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. I |
| MFG. APPR. | | D3391 | SHEET 5 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | <small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE FIRMEST ASSURANCE THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small> | |

RELEASED
2011-11-04


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |


NOTE: Date & initial all entries

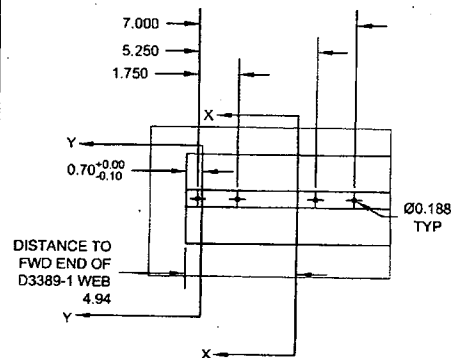

DETAIL J
SCALE 4X

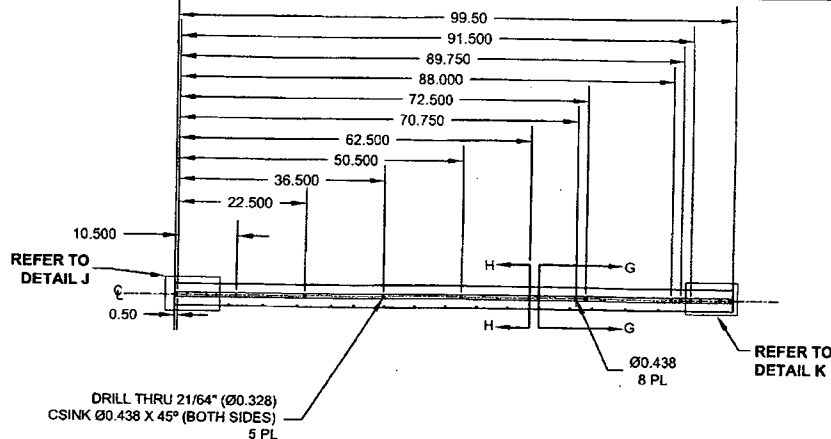


D3391-023 ASSEMBLY DETAIL

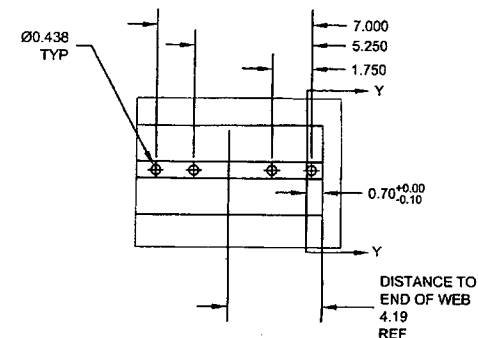


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

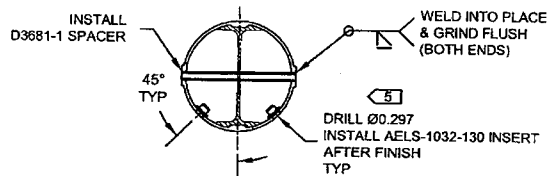

SECTION H-H
SCALE 5X

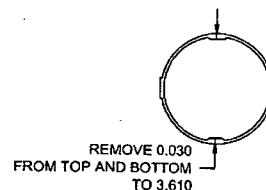

SECTION X-X
SCALE 5X

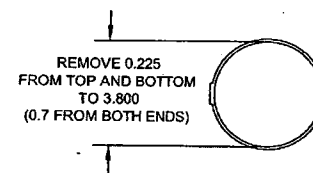

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

| QTY - | PART NUMBER | DESCRIPTION |
|-------|---------------|-------------------|
| 023 | | |
| X | D3391-023 | MID TUBE ASSEMBLY |
| 1 | D2500-1-100 | EXTRUSION |
| 1 | D3389-1 | WEB |
| 5 | D3681-1 | SPACER |
| 20 | AELS-1032-130 | INSERT |

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

| | | | |
|------------|----------|---|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. 1 |
| MFG. APPR. | | D3391 | SHEET 6 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC | |

RELEASED
2011-11-04

83863


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |


NOTE: Date & initial all entries

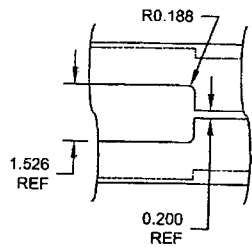

VIEW BB-BB
SCALE 4X

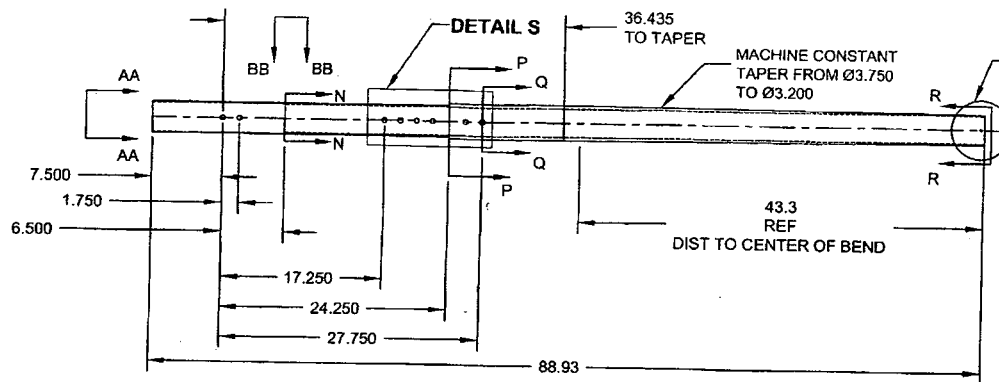


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

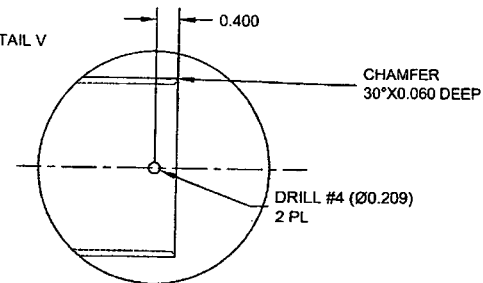


DETAIL V
SCALE 6X


03863

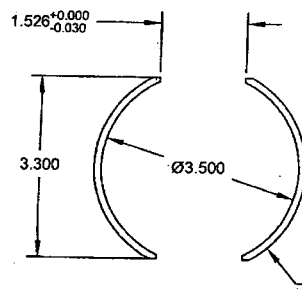


SECTION AA-AA
SCALE 6X

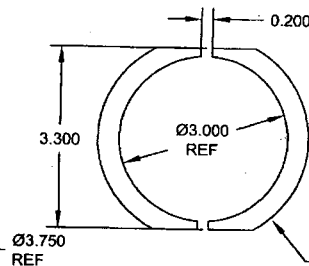


SECTION N-N
SCALE 6X

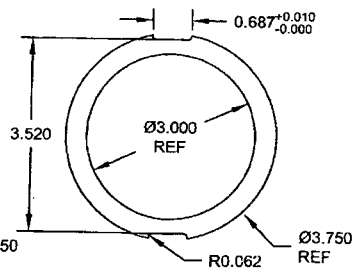


SECTION P-P
SCALE 6X

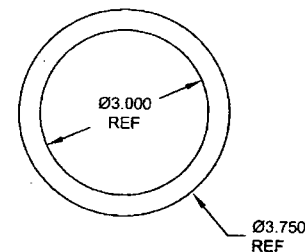


SECTION Q-Q
SCALE 6X

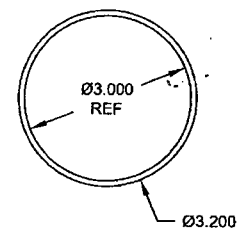

SECTION R-R
SCALE 6X

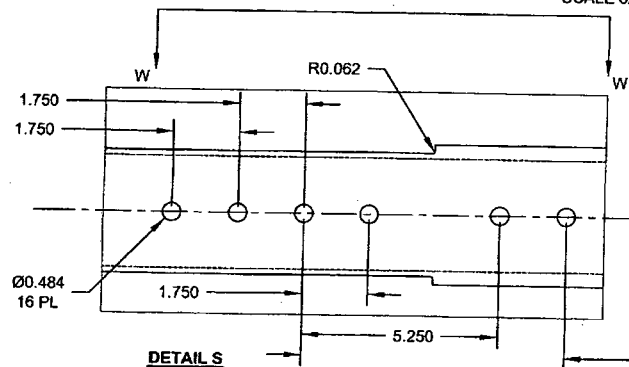

DETAIL S
SCALE 4X

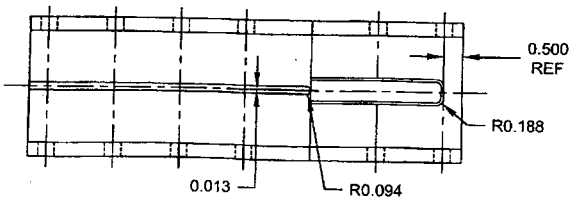

VIEW W-W
SCALE 4X

RELEASED
2011-11-04

| | | | |
|---|----------|---|--------------|
| DESIGN | RH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. I |
| MFG. APPR. | | D3391 | SHEET 7 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC | |
| THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR LOANED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | | | |


| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |


NOTE: Date & initial all entries

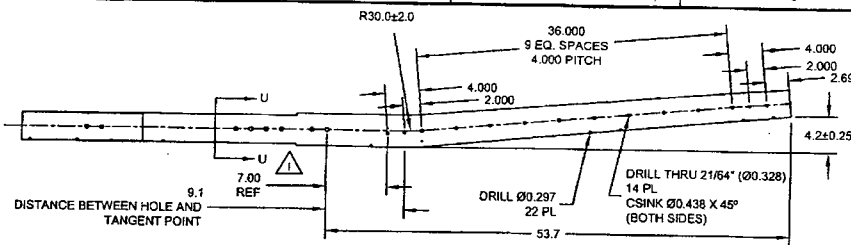


D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

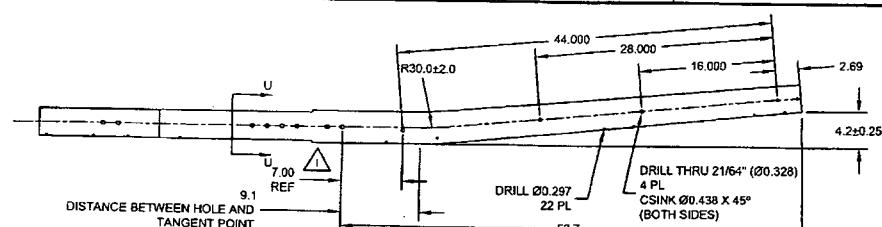

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

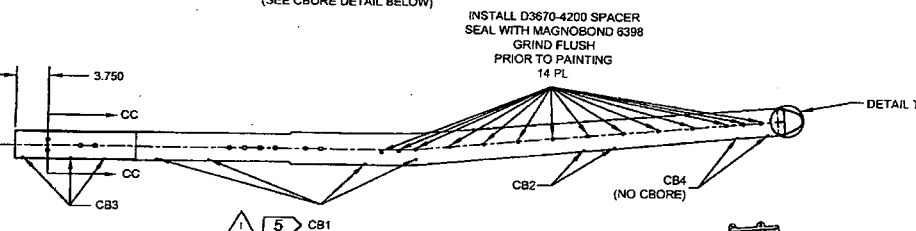




D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

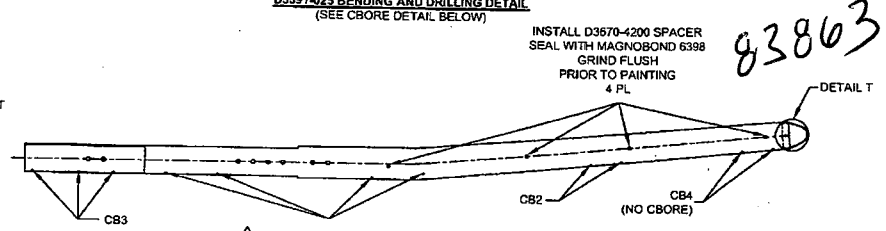

D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

| QTY - 015 | QTY - 025 | PART NUMBER | DESCRIPTION |
|-----------|-----------|---------------|-------------------|
| X | X | D3391-015 | AFT TUBE ASSEMBLY |
| | | D3391-025 | AFT TUBE ASSEMBLY |
| 1 | 1 | D2646 | AFT CAP |
| 14 | 4 | D3670-4200 | SPACER |
| 2 | 2 | D3672-1 | WASHER |
| 1 | 1 | D4095-049 | WEARPAD |
| 1 | 1 | D4095-047 | WEARPAD |
| 1 | 1 | D6014-090 | AFT TUBE |
| 14 | 14 | AELS-1032-130 | INSERT |
| 8 | 8 | AELS-1032-225 | INSERT |
| 4 | 4 | ALS4-428-165 | INSERT |
| 6 | 6 | AN3C4A | BOLT |
| 4 | 4 | AN3C5A | BOLT |
| 10 | 10 | AN960C10L | WASHER |

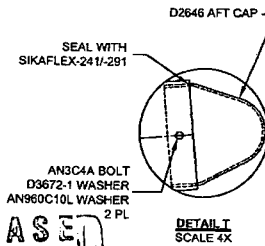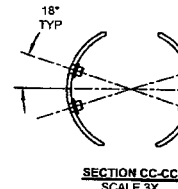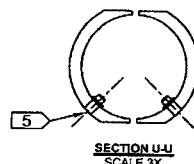

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

| HOLES MARKED | QTY D3391-015 | QTY D3391-025 | CBORE | P/N |
|--------------|---------------|---------------|----------------|---------------|
| CB1 | 8 | 8 | Ø0.430 X 0.170 | AELS-1032-225 |
| CB2 | 4 | 4 | Ø0.430 X 0.170 | AELS-1032-130 |
| CB3 | 6 | 6 | Ø0.430 X 0.040 | AELS-1032-130 |
| CB4 | 4 | 4 | NONE | AELS-1032-130 |

RELEASED
2011-11-04

| | | | |
|------------|----------|--|--------------|
| DESIGN | PH | DART AEROSPACE USA, INC | |
| DRAWN | XDF | KENT, WA | |
| CHECKED | | DRAWING NO. | REV. I |
| MFG. APPR. | | D3391 | SHEET 8 OF 8 |
| APPROVED | | TITLE | SCALE |
| DE APPR. | | 412 FLOAT SKIDTUBE | NTS |
| DATE | 11.10.13 | COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. | |

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries